

Product Information

Date: January 11, 2012

Products: SR150 (Wireless Siren with Built-in Strobe)

Subject: New firmware version 2.10 released
New hardware revision (ECO#K040)

Downloads: To download SR150 firmware v2.10, *[click here](#)
To download the SR150 data sheet and manual, *[click here](#)
To download the firmware upgrade instructions, [click here](#)
**requires login name and password to download*


Resolved Panel supervision of siren option

Issues: The '*Panel supervision of siren*' option (Section [587]) that triggers the SR150's siren and strobe for 5 minutes if communication is lost (squawk once and flash every 4 seconds), is no longer available with the SR150 v2.10.

A couple of customers reported that this feature would in rare occasions falsely trigger. Upon reviewing this feature, we have decided to remove the panel supervision of siren option and only offer the standard siren supervision, as we do with all other wireless transmitters.

Screw removal tamper switch

The SR150 with hardware ECO#K040 now only offers a dual tamper protection, instead of the triple tamper protection with previous hardware. The tamper switch that detected the screw removal has now been removed. We discovered that in specific weather conditions, there were a small percentage of times that the tamper switch was very sensitive to climate change and would generate false tamper alarms. Removing this tamper switch from the hardware does not change or affect the product's security, whereas it is still protected from being removed from the wall, or if its cover has been removed.

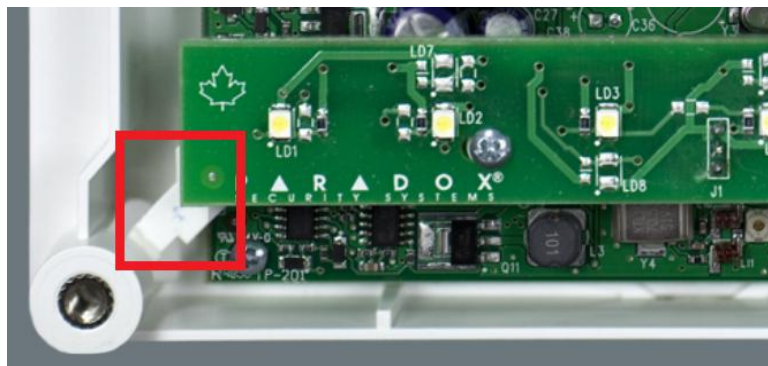

Contact: If you require any additional information or if you have any questions, please do not hesitate to contact our Support department.

Email: support@paradox.com

Fax: 450.491.2313

Phone: 1.800.791.1919 (N. America)

00.1.450.491.7444 (International)

Paradox Security Systems LTD – Product Information #SR150-012-01-11